


Support Units for Light Load and Small Equipment

Clean support unit featuring proven low dust emissions and low torque. The new series is bolstered by higher antirust properties and a wider lineup.



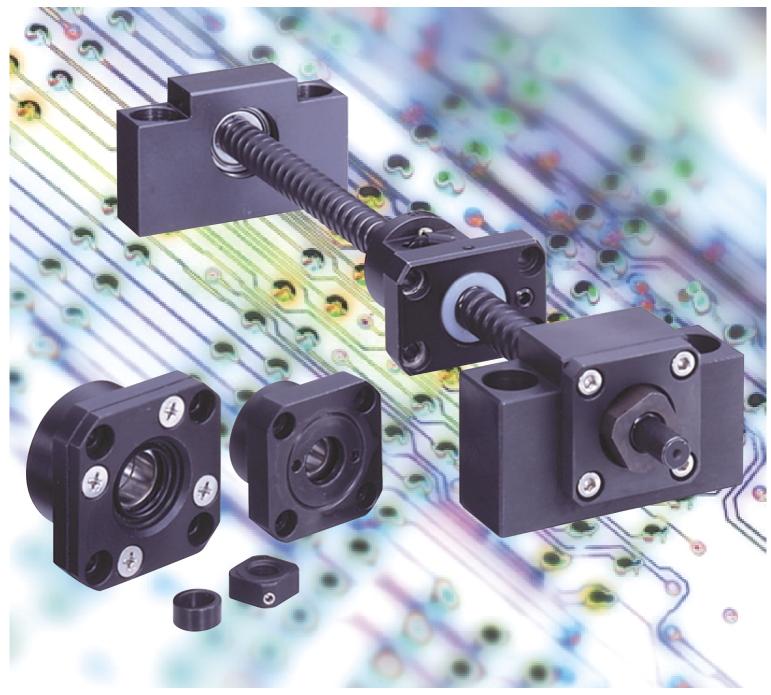

Support Units for Light Load and Small Equipment

Support units for light load and small equipment provide both fixed and support side bearing assemblies to support screw shafts. They provide all required parts such as bearing locknuts so that you can mount them directly to NSK standard ball screws, of which shaft ends are machined.

Please refer to the dimensions listed on the dimension table for configuration of standard screw shaft ends for NSK standard ball screws with blank shaft ends. For rolled ball screws, you require optional spacers when mounting fixed support side support units.

Features

Prompt delivery

All support units are standard stocked items.

Best selection of bearings for your application

General use support units for fixed support side are equipped with highly rigid angular contact ball bearings that have been assembled with proper preload, and packed with the appropriate volume of grease. On the other hand, clean support units for fixed support side uses low dust emission grease, and low torque special bearings. Sealed deep groove ball bearings are used for simple support side units for both general and clean environment use.

Accessories


Support units provide everything necessary for mounting ball screws to machines.

(Please refer to the table on the right.)

* Do not disassemble fixed support side units as they are equipped with bearings and oil seals.

Antirust treatment

The table on the right shows the surface treatment for the bearing housing, and material of small parts.

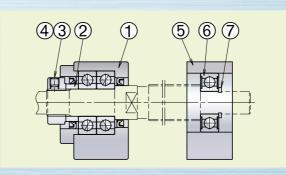

Fixe	ed support side	Simple support side						
Part no.	Name of parts	Part no.	Name of parts					
1	Bearing housing	⑤	Bearing housing					
2	Spacer	6	Bearing					
3	Locknut	7	Snap ring					
4	Set screw with set piece							

	General support unit
Bearings and grease	Angular contact ball bearings, PS2
Surface treatment	Black oxide
Screws and snap rings	Standard material

Specifications of support unit for general use

	Fixed support side	e support un	nit		Simple s	support side su	pport unit
	Axia	l direction		Maximum		Description	Radial direction
Reference no.	Basic dynamic load rating C_a [N]	Load limit [N]	Stiffness [N/µm]	starting torque [N•cm]	Reference no.	Bearing reference no.	Basic dynamic load rating C [N]
WBK06-01A (square) WBK06-11 (round)	2 670	1 040	28	0.49	_	_	_
WBK08-01A (square) WBK08-11 (round)	4 400	1 450	53	0.88	WBK08S-01 (square)	606ZZ	2 260
WBK10-01A (square) WBK10-11 (round)	6 600	2 730	94	1.9	WBK10S-01 (square)	608ZZ	3 300
WBK12-01A (square) WBK12-11 (round)	7 100	3 040	104	2.1	WBK12S-01 (square)	6000ZZ	4 550
WBK15-01A (square) WBK15-11 (round)	7 600	3 380	113	2.3	WBK15S-01 (square)	6002ZZ	5 600
WBK17-01A (square)	13 400	5 800	148	2.8	WBK17S-01 (square)	6203ZZ	9 550
WBK20-01 (square) WBK20-11 (round)	17 900	8 240	155	5.4	WBK20S-01 (square)	6204ZZ	12 800
WBK25-01 (square) WBK25-11 (round)	20 200	10 000	192	7.2	WBK25S-01 (square)	6205ZZ	14 000
WBK04R-11 (round)	615	490	6.5	0.59			_
WBK06R-11 (round)	1 280	930	9	0.59	_	_	_

Support Units for Light Load and Small Equipment

Features of Clean Support Unit

New

Outstanding low dust emission

Clean support unit uses "NSK clean grease LG2" which has a proven feature of low dust emission. It reduces dust emission to 1/10 of general support units.

Low torque


It features low torque characteristics because of special bearings. (50% lower than general support unit.)

High antirust specification

Low temperature chrome plating is applied to bearing housings, retaining plates, locknuts and spacers to improve antirust properties. Moreover, bolts and snap rings are made of stainless steel.

The table below shows the surface treatment of the bearing housing and material of small parts.

	Clean support unit
Bearing-grease	Special bearings, LG2
Surface treatment	Low temperature chrome plating
Set screw and snap ring material	Stainless steel

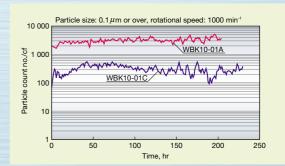




Clean support unit specifications

	Fixed support sid	de support ur	nit		Simple support side support unit					
	Axia	al direction		Maximum			Radial direction			
Reference no.	Basic dynamic load rating C_a [N]	Load limit [N]	Stiffness [N/µm]	starting torque [N•cm]	Reference no.	Bearing reference no.	Basic dynamic load rating C [N]			
WBK08-01C (square)	3 100	1 100	36	0.50	WDK096 016	606VV	0.060			
WBK08-11C (round)	3 100	1 100	30	0.52	WBK08S-01C	606V V	2 260			
WBK10-01C (square)	4 250	1 364	50	1.1	WBK10S-01C	608VV	3 300			
WBK10-11C (round)	4 230	1 304	30	1.1	WBK103-01C	0087.0	3 300			
WBK12-01C (square)	4 700	2 443	57	1.2	WBK12S-01C	6000VV	4 550			
WBK12-11C (round)	4 700	2 443	57	1.2	WBK125-01C	0000V V	4 550			
WBK15-01C (square)	F 100	0.757	60	1.0	WDV150 010	6000///	F 600			
WBK15-11C (round)	5 100	2 757	63	1.3	WBK15S-01C	6002VV	5 600			


Configuration of reference number

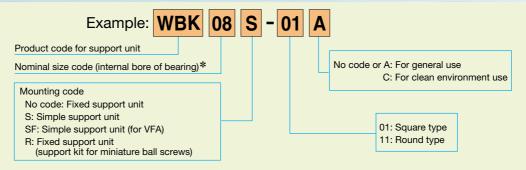

^{*} In case of simple support unit, be careful that 12 or less size codes do not represent internal bores of bearing. Please refer to the dimensional table for internal bore of bearing.

Dimensions of Square Type Support Unit

Fixed support side support unit (square type)

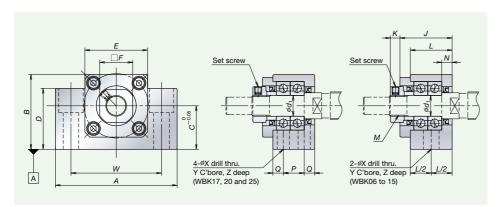


Reference no.	Locknut tightening torque (reference) [N•cm]	Set screw tightening torque (reference) [N•cm]
WBK06-**	245	69 (M3)
WBK08-**	490	69 (M3)
WBK10-**	930	147 (M4)
WBK12-**	1 370	147 (M4)
WBK15-**	2 350	147 (M4)
WBK17-**	3 145	147 (M4)
WBK20-**	4 700	147 (M4)
WBK25-**	8 400	490 (M6)

Units: mm

Refere	ence no.						F	Fixed	supp	ort sic	de su	pport	unit (s	squar	e typ	e)			
For general use	For clean environment use	d ₁	Α	В	С	D	E	F	J	К	L	N	P	Q	W	X	Y	Z	М
WBK06-01A		6	42	25	13	20	18	12	20	5.5	_	3.5	_	_	30	5.5	9.5	11	M6 × 0.75
WBK08-01A	WBK08-01C	8	52	32	17	26	25	14	23	7	_	4	_	_	38	6.6	11	12	M8 × 1
WBK10-01A	WBK10-01C	10	70	43	25	35	36	17	30	5.5	24	6	_	_	52	9	14	11	M10 × 1
WBK12-01A	WBK12-01C	12	70	43	25	35	36	19	30	5.5	24	6	_	_	52	9	14	11	M12 × 1
WBK15-01A	WBK15-01C	15	80	50	30	40	41	22	31	12	25	5	_	_	60	11	17	15	M15 × 1
WBK17-01A		17	86	64	39	55	50	24	44	7	35	7	19	8	68	9	14	11	M17 × 1
WBK20-01		20	95	58	30	45	56	30	52	10	42	10	22	10	75	11	17	15	M20 × 1
WBK25-01		25	105	68	35	25	66	36	61	13	48	14	30	9	85	11	No co bo	ounter res	M25 × 1.5

Simple support side support unit

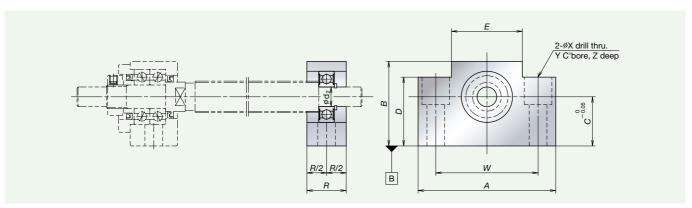


Units: mm

Refere	ence no.				Simple s	upport si	de suppo	rt unit (so	uare type)		
For general use	For clean environment use	d ₂	R	Α	В	С	D	Ε	W	X	Y	Z
WBK08S-01	WBK08S-01C	6	15	52	32	17	26	25	38	6.6	11	12
WBK10S-01	WBK10S-01C	8	20	70	43	25	35	36	52	9	14	11
WBK12S-01	WBK12S-01C	10	20	70	43	25	35	36	52	9	14	11
WBK15S-01	WBK15S-01C	15	20	80	50	30	40	41	60	9	14	11
WBK17S-01		17	23	86	64	39	55	50	68	9	14	11
WBK20S-01		20	26	95	58	30	45	56	75	11	17	15
WBK25S-01		25	30	105	68	35	25	66	85	11	No coun	ter bores

Dimensions of Round Type and Miniature Support Unit

Fixed support side support unit (round type)

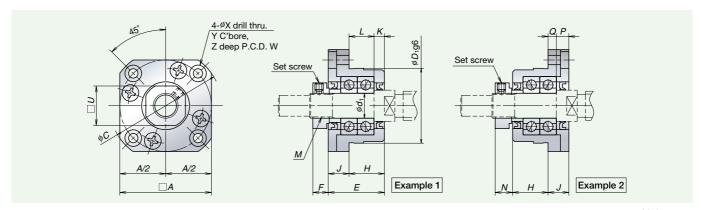

Units: mm

Refer	ence no.							Fixe	ed su	pport	side s	suppo	rt unit	(roun	d typ	e)				
For general use	For clean environment use	d ₁	Α	С	<i>D</i> ₁	Ε	F	Н	J	K	L	N	Р	Q	U	W	Х	Y	Z	М
WBK06-11		6	28	35	22	20	5.5	13	7	3.5	9.5	6.5	4.5	2.5	12	28	2.9	5.5	3.5	M6 × 0.75
WBK08-11	WBK08-11C	8	35	43	28	23	7	14	9	4	10	8	5	4	14	35	3.4	6.5	4	M8 × 1
WBK10-11	WBK10-11C	10	42	52	34	27	7.5	17	10	5	12	8.5	6	4	17	42	4.5	8	4	M10 × 1
WBK12-11	WBK12-11C	12	44	54	36	27	7.5	17	10	5	12	8.5	6	4	19	44	4.5	8	4	M12 × 1
WBK15-11	WBK15-11C	15	52	63	40	32	12	17	15	6	11	14	8	7	22	50	5.5	9.5	6	M15 × 1
WBK20-11		20	68	85	57	52	10	30	22	10	20	14	14	8	30	70	6.6	11	10	M20 × 1
WBK25-11		25	79	98	63	57	13	30	27	10	20	20	17	10	36	80	9	15	13	M25 × 1.5


 $[\]boldsymbol{\divideontimes}$ Refer to the table of square type for tightening torque of locknuts and setscrews.

Notes:

- 1. Use datum face A or B to mount a square type support unit to a machine base.
- 2. Tighten a set screw after a locknut is adjusted and tightened.
- 3. Insert the set piece that is provided with support unit to a screw hole, and then tighten the set screw.

Support kits for miniature ball screws

Support kits are for the RMS precision rolled miniature ball screw series. However, please use support units for general use in case of RMA1002 or larger rolled ball screws.

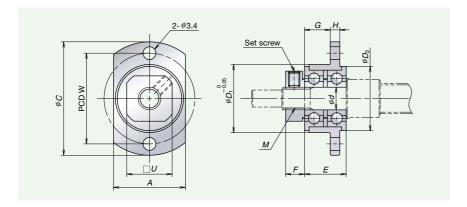

Notes:

- Oscillate bearings slowly so that they fall into a place to make run-out of mounting face minimal, and then tighten a locknut.
- 2. A support kit is put on a provisional shaft (bolt) for shipping.

Units: mm

	Reference no.	А	С	d	<i>D</i> ₁	<i>D</i> ₂	Ε	F	G	Н	W	U	М	Applicable ball screw	Locknut tightening torque (reference) [N•cm]	Setscrew tightening torque (reference) [N•cm]
	WBK04R-11	14	25	4	13	12.5	9	5	5	2.5	19	10	$M4 \times 0.5$	RMA0601	147	38 (M2.5)
•	WBK06R-11	19	30	6	18	17	11	5	6.8	2.5	24	12	M6 × 0.75	RMA0801 RMA0801.5 RMA0802	245	69 (M3)

Dimensions of Simple Support Side Support Units for VFA Ball Screws

Simple support side support units for VFA ball screws

Units: mm

20 70	10 10	36 2-ø9 drill thru. Ø14 C'bore, 11 deep
-------	-------	--


Reference no.	d	Applicable ball screw
WBK12SF-01	12	VFA1210
WBK15SF-01	15	VFA1510 VFA1520

- 1. Use datum face A for mounting to a machine
- 2. This type is exclusively made for simple support side units for NSK VFA ball screws. This unit supports a ball screw outside of a screw shaft.

Dimensions of Locknut

Locknut

It is essential to align a ball screw to exhibit its full performance. For this reason, we provide standard locknuts exclusive for ball screws, of which perpendicularities are controlled against the screw thread.

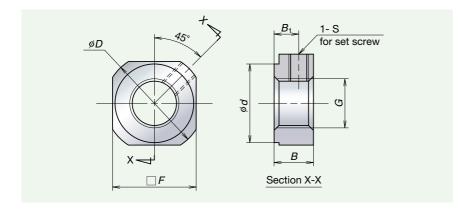

- 1. Fasten the set screw after adjusting run-out of support kit and tightening a locknut.
- 2. Insert the set piece (bras pad) that is provided with a support kit, and then fasten the

Units: mm


Reference no.	G	D	F	В	d	B ₁	S	Locknut tightening torque (reference) [N•cm]	Set screw tightening torque (reference) [N•cm]	
WBK06L-01	M6×0.75	14.5	12	5	10	2.7	М3	245	69 (M3)	
WBK08L-01	M8×1	17	14	6.5	13	4	M3	490	69 (M3)	
WBK10L-01	M10×1	20	17	8	16	5	M4	930	147 (M4)	
WBK12L-01	M12×1	22	19	8	17	5	M4	1 370	147 (M4)	
WBK15L-01	M15×1	25	22	10	21	6	M4	2 350	147 (M4)	
WBK17L-01	M17×1	29	24	13	24	8	M4	3 145	147 (M4)	
WBK20L-01	M20×1	35	30	13	26	8	M4	4 700	147 (M4)	
WBK25L-01	M25×1.5	42	36	16	34	10	M6	8 400	490 (M6)	

Dimensions of Spacer

Spacer

It requires an optional spacer to the side where ball thread is cut through, such as a rolled ball screw shaft when mounting the support unit for fixed support side.

Units: mm

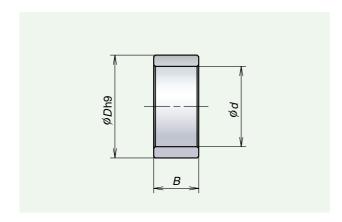

Reference no.	Internal diameter, d	Outside diameter, D	Width <i>B</i>	Applicable support unit			
WBK06K	6	9.5	5.0	WBK06-**			
WBK08K	8	11.5	5.5	WBK08-**			
WBK10K	10	14.5	5.5	WBK10- **			
WBK12K	12	15.0	5.6	WBK12-**			
WBK15K	15	19.5	10.0	WBK15- **			
WBK17K	17	24.4	7.0	WBK17-**			
WBK20K	20	25.5	11.0	WBK20- **			
WBK25K	25	32.0	14.0	WBK25- **			


Dimensions of Screw Shaft End Configuration

Screw shaft end configuration

WBK06R-11

 $M6 \times 0.75$

Dimensions of shaft end configurations are shown on the table below for the light load and small equipment support units. Add a spacer width (B on the above table for spacers) to L₁ dimension below when using a spacer for a rolled ball screw.

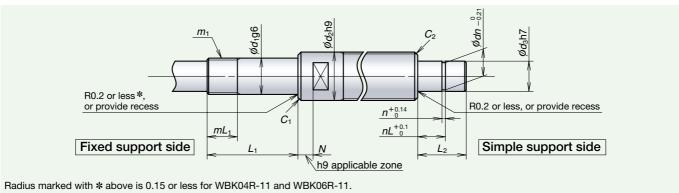

Units: mm

Fixed support side							Simple support side							
Deference no	Bearing journal		Locknut thread		Sealing part		Chamfer		Bearing journal		Snap ring groove			Chamfer
Reference no.	d ₁	L ₁	<i>m</i> ₁	mL ₁	d ₂	N	C ₁	Reference no.	d ₃	L ₂	n	dn	nL	C ₂
WBK06-**	6	22.5	M6 × 0.75	7	9.5	3.5	0.2		_	_	_	_	—	_
WBK08-**	8	27	M8 × 1	9	11.5	4	0.2	WBK08S-**	6	9	0.8	5.7	6.8	0.2
WBK10-**	10	30	M10×1	10	14	6	0.2	WBK10S-**	8	10	0.9	7.6	7.9	0.2
WBK12-**	12	30	M12 × 1	10	15	6	0.2	WBK12S-**	10	22	1.15	9.6	9.15	0.5
WBK15-**	15	40	M15×1	15	19.5	5	0.3	WBK15S-**	15	25	1.15	14.3	10.15	0.5
WBK17-**	17	46	M17 × 1	17	24	7	0.3	WBK17S-**	17	16	1.15	16.2	13.15	0.5
WBK20-**	20	53	M20 × 1	16	25	10	0.3	WBK20S-**	20	19	1.35	19	15.35	0.5
WBK25- **	25	62	M25 × 1.5	20	32	14	0.5	WBK25S- **	25	20	1.35	23.9	16.35	0.5
WBK04R-11	4	15	M4 × 0.5	7.5	_	_	0.3	Regarding support units for heavy loads and machine tools,						

Regarding support units for heavy loads and machine tools, please refer to the Catalog "Precision Machine Components."